


400			
DIMENSIONS		cm	
A	1/2"	1.5	MIN.
B	1-1/2"	4	ТО
	2"	5	
0	1"	2.5	MIN.

NOTES:

- 1. REMOVE ALL LEAD AND OTHER FLASHING BEFORE INSTALLING FIELD FABRICATED PIPE SEAL.
- 2. TEMPERATURE OF THE PIPE PENETRATION MUST NOT EXCEED 140°F (60°C) WHEN USING PVC AND 160°F (71°C) WHEN USING TPO FLASHING.
- 3. APPLY HEAT TO FLASHING AND FORM BY HAND PRIOR TO HOT AIR WELDING
- 4. MECHANICAL SECUREMENT IS REQUIRED AROUND ALL PIPES GREATER THAN 18" (46cm) IN DIAMETER.
- 5. REFER TO THERMOPLASTIC COMMON DETAILS FOR HOT STACK, STEEL TUBING & FLEXIBLE PENETRATIONS.



FIELD FABRICATED PIPE FLASHING

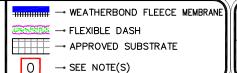

THERMOPLASTIC WEATHERBOND FLEECE ADHERED