


NOTES:

1. REMOVE ALL LEAD AND OTHER FLASHING BEFORE INSTALLING FIELD FABRICATED PIPE SEAL.
2. TEMPERATURE OF METAL COLLAR MUST NOT EXCEED 180°F (82°C).
3. EPDM PRIMER MUST BE APPLIED TO THE MATING SURFACES PRIOR TO APPLYING PEEL & STICK UNCURED EPDM FLASHING.
4. IN COLDER TEMPERATURES, A HEAT GUN MUST BE USED WHEN FORMING PEEL & STICK UNCURED EPDM FLASHING.



	mm
0.5"	= 13
1.0"	= 25
5.0"	= 127
5.5"	= 140
6.0"	= 152

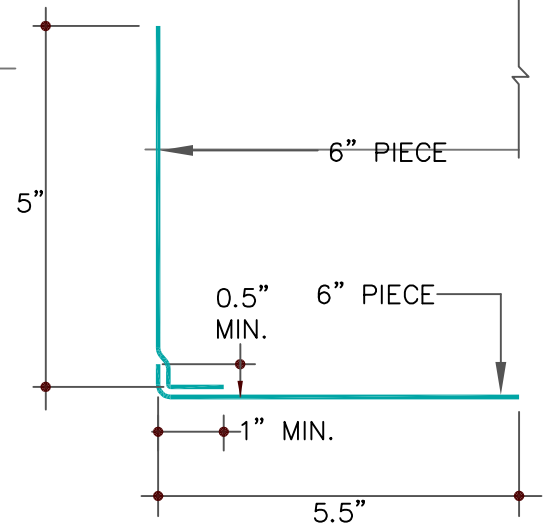

FIELD FABRICATED HOT STACK

- EPDM MEMBRANE
- APPROVED SUBSTRATE
- SEE NOTE

EPDM ROOFING SYSTEM
WBRC-8.5