



NOTES:

1. REMOVE ALL LEAD AND OTHER FLASHING BEFORE INSTALLING PEEL & STICK UNCURED EPDM FLASHING.
2. TEMPERATURE OF PIPE MUST NOT EXCEED 180°F (82°C).
3. HPWX FASTENERS AND POLYMER SEAM PLATES ARE REQUIRED OVER STEEL DECKS.
4. EPDM PRIMER MUST BE APPLIED TO THE PIPE & MEMBRANE SURFACE PRIOR TO APPLYING PEEL & STICK CURED COVER STRIP (OVER FASTENING PLATES) AND PEEL & STICK UNCURED EPDM FLASHING.

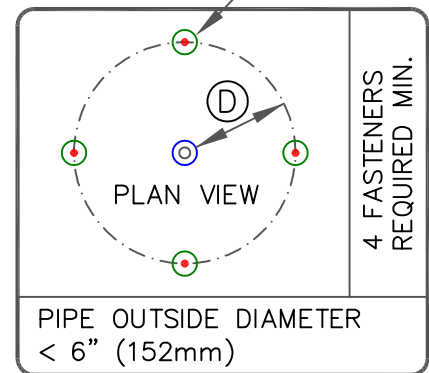

DIMENSIONS		mm	
(A)	1/2"	13	
(B)	3"	76	
(C)	1"	25	
(D)	6"	152	TO
	12"	305	
(E)	12"	305	MAX.

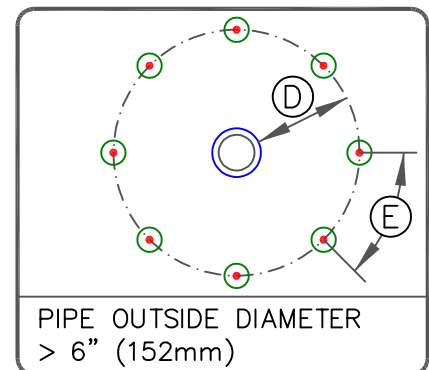

FIELD FABRICATED PIPE SEAL

- REINFORCED EPDM—UNLESS NOTED OTHERWISE
- APPROVED SUBSTRATE
- SEE NOTE

MECHANICALLY ATTACHED EPDM

WBRMA-8.2